Smart Fiber Amplifier Units

E3NX-FA

CSM_E3NX-FA_DS_E_7_1

CE

The Advanced Fiber Amplifier Units That Handles On-site Needs

- Improved basic performance with 1.5 times the sensing distance and approx. 1/10th the minimum sensing object.*
- Ultra-easy setup with Smart Tuning with a dynamic range expanded 20 times to 40,000:1. Optimum stable detection achieved with light level adjustment even for saturated incident light.
- White on black display characters for high visibility.
- Solution Viewer that shows the passing time and difference in incident levels and Change Finder that shows even high-speed workpieces to achieve simple settings and reliable detection.
- * Compared to the E3X-HD.



For the most recent information on models that have been certified for safety standards, refer to your OMRON website.



Refer to the *Safety Precautions* on page 12.

Ordering Information

Fiber Amplifier Units (Dimensions → pages 13 and 15)

Туре	Connecting method	Appearance	Inputs/outputs	Мо	del
туре	Connecting method	Appearance	inputs/outputs	NPN output	PNP output
Standard models	Pre-wired (2 m)		1 output	E3NX-FA11 2M	E3NX-FA41 2M
Ciandard models	Wire-saving Connector		1 output	E3NX-FA6	E3NX-FA8
	Pre-wired (2 m)		2 outputs + 1 input	E3NX-FA21 2M	E3NX-FA51 2M
Advanced models			1 output + 1 input	E3NX-FA7	E3NX-FA9
Advanced models	Wire-saving Connector		2 outputs	E3NX-FA7TW	E3NX-FA9TW
	M8 Connector	and the second	1 output + 1 input	E3NX-FA24	E3NX-FA54
	Wio Connector		2 outputs		E3NX-FA54TW
Model for Sensor Communications Unit *	Connector for Sensor Communications Unit			E3NX-FA0	

^{*} A Sensor Communications Unit is required if you want to use the Amplifier Unit on a network.

Accessories (Sold Separately)

Wire-saving Connectors (Required for models for Wire-saving Connectors.) (Dimensions → page 15)

Connectors are not provided with the Fiber Amplifier Unit and must be ordered separately. *Protective stickers are provided.

Туре	Appearance	Cable length	No. of conductors	Model	Applicable Fiber Amplifier Units
Master Connector			4	E3X-CN21	E3NX-FA7 E3NX-FA7TW
Slave Connector		2 m	2	E3X-CN22	E3NX-FA9 E3NX-FA9TW
Master Connector	*	2 111	3	E3X-CN11	E3NX-FA6
Slave Connector	*		1	E3X-CN12	E3NX-FA8

Sensor I/O Connectors (Required for models for M8 Connectors.) (Dimensions → page 15)

Connectors are not provided with the Fiber Amplifier Unit and must be ordered separately.

Size	Cable	Appearance		Cable	type	Model							
		Straight	Straight	Straight		Straight		Straight		uht .			XS3F-M421-402-A
Mo	Standard ashle	Straight		5m	4-wire	XS3F-M421-405-A							
М8	Standard cable	Lohamad		2m	4-WIIE	XS3F-M422-402-A							
	L-shape	L-snaped		5m		XS3F-M422-405-A							

Mounting Bracket (Dimensions → page 16)

A Mounting Bracket is not provided with the Fiber Amplifier Unit. It must be ordered separately as required.

Appearance	Model	Quantity
	E39-L143	1

DIN Track (Dimensions → page 16)

A DIN Track is not provided with the Fiber Amplifier Unit. It must be ordered separately as required.

Appearance	Туре	Model	Quantity
	Shallow type, total length: 1 m	PFP-100N	
	Shallow type, total length: 0.5 m	PFP-50N	1
	Deep type, total length: 1 m	PFP-100N2	

End Plate (Dimensions → page 16)

Two End Plates are provided with the Sensor Communications Unit. End Plates are not provided with the Fiber Amplifier Unit. They must be ordered separately as required.

Appearance	Model	Quantity
3	PFP-M	1

Related Products

Sensor Communications Units

Type Appearance Model								
Appearance	Model							
	E3NW-ECT							
	E3NW-CRT							
	E3NW-CCL							
	E3NW-DS							
	Appearance							

^{*1.} Refer to your OMRON website for details.

EtherCAT® is a registered trademark and patented technology, licensed by Beckhoff Automation GmbH, Germany.

CompoNet is a registered trademark of the ODVA. CC-Link is a registered trademark of Mitsubishi Electric Corporation. The trademark is managed by the CC-Link Partner Association.

^{*2.} The Distributed Sensor Unit can be connected to any of the Sensor Communications Units.

Ratings and Specifications

		Туре	Standard	l models		A	dvanced mod	dels		Model for Sensor Communications Unit
		NPN output	E3NX-FA11	E3NX-FA6	E3NX-FA21	E3NX-FA7	E3NX-FA7TW	E3NX-FA24	-	
		PNP output	E3NX-FA41	E3NX-FA8	E3NX-FA51	E3NX-FA9	E3NX-FA9TW	E3NX-FA54	E3NX-FA54TW	E3NX-FA0
Item Connecting method			Pre-wired	Pre-wired Wire-saving Connector Pre-wired Wire-saving Connector M8 Connector				nnector	Connector for Sensor Communications Unit	
Inputs/outputs	Outputs		1 output	1 output 2 outputs 1 output 2 outputs 1 output 2 outputs					*1	
inputs/outputs	External in	nputs			1 input	1 input		1 input		'
Light source (wa	avelength)		Red, 4-eleme	ent LED (625 r	nm)	•				
Power supply vo	oltage		10 to 30 VDC	, including 10	% ripple (p-p)					
Power consump	tion°2		Standard Mo Normal mod Power savin Advanced Mo Normal mod Power savin	ng eco mode: odels: de: 1,080 mW	for Sensor Conax. (Current 840 mW max max. (Current 930mW max	consumption: . (Current control t consumption) (Current control	40 mA max.), nsumption: 35 n: 45 mA max sumption: 40 i	mA max.) .),		
Control output			Load current: 20 mA max. Residual vo At load cu	Groups of 1 t	o 3 Amplifier han 10 mA: 1	Units: 100 m/	A max., Group	s of 4 to 30 Am	nplifier Units:	
			OFF current: 0.1 mA max.							
External inputs					Refer to *3.			Refer to *3.		
Indicators			7-segment displays (Sub digital display: green, Main digital display: white) Display direction: Switchable between normal and reversed. OUT indicator (orange), L/D indicator (orange), ST indicator (blue), DPC indicator (green), and OUT selection indicator (orange, only on models with 2 outputs)							
Protection circu	its		Power supply reverse polarity protection, output short-circuit protection, and output reverse polarity protection and output short-circuit protection.						reverse polarity protection and	
	Super-hig (SHS)*4	h-speed mode	Operate or re	set for model	with 1 output:	30 μs, with 2	! outputs: 32 μ	s		1
Response time	High-spee	ed mode (HS)	Operate or re	set: 250 μs						
•	Standard	mode (Stnd)	Operate or re	set: 1 ms						
	Giga-pow	er mode (GIGA)	Operate or re	set: 16 ms						
Sensitivity adjus	stment			(2-point tunir uning (–99% to				num sensitivity	tuning, power	tuning, or
No. of Units for	Super-hig (SHS)*4	h-speed mode	0							
mutual interference	High-spee	ed mode (HS)	10							
prevention	Standard	mode (Stnd)	10							
	Giga-pow	er mode (GIGA)	10							
	Automatic (APC)	power control	Always enabl	ed.						
_	Dynamic (DPC)	oower control	Provided							
Functions	Timer		Select from ti 1 to 9,999 ms	mer disabled,	OFF-delay, C	N-delay, one	-shot, or ON-o	delay + OFF-de	elay timer:	
	Zero reset	1	Negative valu	ies can be dis	played. (Thre	shold value is	shifted.)			
	Resetting	settings*5	Select from in	nitial reset (fac	tory defaults)	or user reset	(saved setting	gs).		

*1. Two sensor outputs are allocated in the programmable logic controller PLC I/O table.
PLC operation via Communications Unit enables reading detected values and changing settings.

*2. At Power Supply Voltage of 10 to 30 VDC.
Standard Models or Model for Sensor Communications Unit:
Normal mode: 1,080 mW max. (Current consumption: 36 mA max. at 30 VDC, 108 mA max. at 10 VDC)
Power saving eco mode: 930 mW max. (Current consumption: 31 mA max. at 30 VDC, 93 mA max. at 10 VDC)
Advanced Models:

Normal mode: 1,230 mW may. (Current consumption: 44 mA may. at 30 VDC, 103 mA may. at 10 VDC)

Normal mode: 1,230 mW max. (Current consumption: 41 mA max. at 30 VDC, 123 mA max. at 10 VDC)

Power saving eco mode: 1,050 mW max. (Current consumption: 35 mA max. at 30 VDC, 105 mA max. at 10 VDC)

*3. The following details apply to the input.

	Contact input (relay or switch)	Non-contact input (transistor)	Input time
NPN	ON: Shorted to 0 V (Sourcing current: 1 mA max.). OFF: Open or shorted to Vcc.	ON: 1.5 V max. (Sourcing current: 1 mA max.) OFF: Vcc – 1.5 V to Vcc (Leakage current: 0.1 mA max.)	ON: 9 ms min.
PNP	ON: Shorted to Vcc (Sinking current: 3 mA max.). OFF: Open or shorted to 0 V.	ON: Vcc – 1.5 V to Vcc (Sinking current: 3 mA max.) OFF: 1.5 V max. (Leakage current: 0.1 mA max.)	OFF: 9 ms min.

^{*4.} The mutual interference prevention function is disabled if the detection mode is set to super-high-speed mode. *5. The bank is not reset by the user reset function or saved by the user save function.

		Туре	Standard	l models		Ac	Ivanced mo	dels		Model for Sensor Communications Unit
		NPN output	E3NX-FA11	E3NX-FA6	E3NX-FA21	E3NX-FA7	E3NX-FA7TW	E3NX-FA24	-	E3NX-FA0
		PNP output	E3NX-FA41	E3NX-FA8	E3NX-FA51	E3NX-FA9	E3NX-FA9TW	E3NX-FA54	E3NX-FA54TW	LSNX-I AU
Item Connecting method			Pre-wired	Wire- saving Connector	Pre-wired		saving nector	M8 Co	nnector	Connector for Sensor Communications Unit
	Eco mode	+	Select from	OFF (digital of	displays lit) or	ECO (digita	al displays no	ot lit).		
	Bank switch	ing	Select from	banks 1 to 4.						
	Power tunin	g	Select from	ON or OFF.						
	Output 1		Select from	normal detec	tion mode or	area detecti	on mode.			
Functions	Output 2				Select from normal detection mode, alarm output mode, or error output mode.		Select from normal detection mode, alarm output mode, or error output mode.			normal detection n output mode, or mode.
	External inp	ut			Select from tuning, pow emission Of reset, or bar switching.	er tuning, FF, zero		Select from input OFF, tuning, power tuning, emission OFF, zero reset, or bank switching.		
	Hysteresis v	vidth	Select from :	standard setti	ng or user se	tting. For a u	ser setting, t	he hysteresis	width can be	set from 0 to 9,999
Ambient illu	mination		Incandescer	nt lamp: 20,00	00 lx max., Si	unlight: 30,0	00 lx max.			
Maximum co	onnectable Un	its	30							
										Operating: Groups of 1 or 2 Amplifier Units:
Ambient ten	nperature rang	ie	Groups of 3 Groups of 1 Groups of 1 Storage: –	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w	r Units: –25 t er Units: –25 fier Units: –2! fier Units: –2! rith no icing o	to 50°C, 5 to 45°C, 5 to 40°C r condensat	ŕ			0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C
Ambient hur	midity range	ie	Groups of 1 Groups of 3 Groups of 1 Groups of 1 Storage: –	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w	er Units: –25 fier Units: –2! fier Units: –2! rith no icing o	to 50°C, 5 to 45°C, 5 to 40°C r condensat	ŕ			0 to 55°C, Groups of 3 to 11 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing of
Ambient hur Insulation re	midity range esistance	je	Groups of 1 Groups of 3 Groups of 3 Groups of 1 Storage: – Operating a 20 MΩ min.	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w	er Units: –25 fier Units: –2! fier Units: –2! rith no icing o	to 50°C, 5 to 45°C, 5 to 40°C r condensat	ŕ			0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o
Ambient hur Insulation re Dielectric str	midity range esistance rength		Groups of 1 Groups of 3 Groups of 1 Groups of 1 Storage: - Operating a 20 MΩ min. 1,000 VAC a	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w and storage: 3 (at 500 VDC)	er Units: –25 fier Units: –25 fier Units: –25 fier Units: –25 ith no icing o	to 50°C, 5 to 45°C, 5 to 40°C r condensat	ensation)			0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o
Ambient hur Insulation re Dielectric str Vibration res	midity range esistance	ruction)	Groups of 1 Groups of 3 Groups of 1 Groups of 1 Storage: – Operating at 20 MΩ min. 1,000 VAC at 10 to 55 Hz	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w and storage: 3 (at 500 VDC) at 50/60 Hz fo with a 1.5-mr	er Units: –25 fier Units: –25 fier Units: –25 fier Units: –25 ith no icing o	to 50°C, 5 to 45°C, 5 to 40°C r condensat	ensation) hours each i	n X, Y, and Z	directions	0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o condensation)
Ambient hur Insulation re Dielectric str Vibration res Shock resist	midity range esistance rength sistance (destruc tance (destruc ked state/Sens	ruction)	Groups of 1 Groups of 3 Groups of 3 Groups of 1 Groups of 1 Storage: – Operating a 20 MΩ min. 1,000 VAC a 10 to 55 Hz 500 m/s² for Approx. 115 g/ approx. 75 g	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w and storage: 3 (at 500 VDC) at 50/60 Hz fo with a 1.5-mr 3 times each Approx. 60g/ approx. 20g	er Units: –25 fier Units: –26 fier Units: –26 fier Units: –26 fier Units: –26 fier Units: –27	to 50°C, 5 to 45°C, 5 to 40°C r condensat with no cond plitude for 2 Z directions	ensation) hours each i	n X, Y, and Z Approx. 65 approx. 25	g/	0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o condensation)
Ambient hur Insulation re Dielectric str Vibration res Shock resist	midity range esistance rength sistance (destruct tance (destruct ked state/Sens	ruction)	Groups of 1 Groups of 3 Groups of 3 Groups of 1 Groups of 1 Storage: – Operating at 20 MΩ min. 1,000 VAC at 10 to 55 Hz Soo m/s² for Approx. 115 g/ approx. 75 g Polycarbona	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w and storage: 3 (at 500 VDC) at 50/60 Hz fo with a 1.5-mr 3 times each Approx. 60g/ approx. 20g ate (PC)	er Units: –25 fier Units: –26 fier Units: –26 for 1 min m double amp n in X, Y, and	to 50°C, 5 to 45°C, 5 to 40°C r condensat with no cond plitude for 2 Z directions	ensation) hours each i	Approx. 65	g/	0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o condensation)
Ambient hur Insulation re Dielectric str Vibration res Shock resist	midity range esistance rength sistance (destruc tance (destruc ked state/Sens	ruction)	Groups of 1 Groups of 3 Groups of 3 Groups of 1 Groups of 1 Storage: – Operating a 20 MΩ min. 1,000 VAC a 10 to 55 Hz 500 m/s² for Approx. 115 g/ approx. 75 g	to 10 Amplifi 1 to 16 Ampli 7 to 30 Ampli 30 to 70°C (w and storage: 3 (at 500 VDC) at 50/60 Hz fo with a 1.5-mr 3 times each Approx. 60g/ approx. 20g ate (PC)	er Units: –25 fier Units: –26 fier Units: –26 for 1 min m double amp n in X, Y, and	to 50°C, 5 to 45°C, 5 to 40°C r condensat with no cond plitude for 2 Z directions	ensation) hours each i	Approx. 65	g/	0 to 55°C, Groups of 3 to 1 Amplifier Units: 0 to 50°C, Groups of 11 to 16 Amplifier Units: 0 to 45°C, Groups of 17 to 30 Amplifier Units: 0 to 40°C Storage: -30 to 70°C (with no icing o condensation)

Sensing Distances

Threaded Models

Sensing	Sensing	Size	Model		Sensin	g distance (mm)	
method	direction	Size	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode
	Right-angle		E32-T11N 2M	3,000	1,500	1,050	280
Through-		M4	E32-T11R 2M	3,000	1,500	1,050	280
beam	Straight	1014	E32-LT11 2M	4,000*1	4,000*1	4,000*1	1,080
			E32-LT11R 2M	4,000*1	4,000*1	3,450	920
	Right-angle	М3	E32-C31N 2M	160	75	69	14
	Right-angle	M6	E32-C11N 2M	1,170	520	480	100
			E32-D21R 2M	210	90	60	16
		M3	E32-C31 2M	490	220	150	44
Reflective			E32-C31M 1M	490	220	150	44
Reflective	Caroloda	M4	E32-D211R 2M	210	90	60	16
	Straight		E32-D11R 2M	1,260	520	360	100
		M6	E32-CC200 2M	2,100	900	600	180
		IVIO	E32-LD11 2M	1,290	540	370	110
			E32-LD11R 2M	1,260	520	360	100

^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

Cylindrical Models

Sensing	Size	Sensing	Model		Sensin	g distance (mm)	
method	od direction		Wodel	Giga mode	Standard mode	High-speed mode	Super-high-speed mode
	1 dia.		E32-T223R 2M	670	370	220	60
	1.5 dia.	Top-view	E32-T22B 2M	1,020	600	330	90
beam	beam 3 dia.		E32-T12R 2M	3,000	1,500	1,050	280
	3 ula.	Side-view	E32-T14LR 2M	1,120	670	390	100
	1.5 dia.		E32-D22B 2M	210	90	60	16
	1.5 dia. + 0.5 dia.		E32-D43M 1M	42	18	12	4
Reflective		Top-view	E32-D22R 2M	210	90	60	16
Reliective	3 dia.	1 op-view	E32-D221B 2M	450	210	130	40
			E32-D32L 2M	1,050	450	300	90
	3 dia. + 0.8 dia.		E32-D33 2M	100	45	30	8

Flat Models

Sensing	Sensing direction	Model	Sensing distance (mm)					
method	ochang unconon	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode		
	Top-view	E32-T15XR 2M	3,000	1,500	1,050	280		
Through- beam	Side-view	E32-T15YR 2M	1,120	670	390	100		
200	Flat-view	E32-T15ZR 2M	1,120					
	Top-view	E32-D15XR 2M	1,260	520	360	100		
Reflective	Side-view	E32-D15YR 2M	300	150	78	24		
	Flat-view	E32-D15ZR 2M	300	150	70	24		

Sleeve Models

Sensing	Canaina direction	Model	Sensing distance (mm)						
method	Sensing direction	Wodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode			
	Side-view	E32-T24R 2M	250	150	75	20			
		E32-T24E 2M	670	370	220	60			
Through- beam		E32-T33 1M	220	130	75	20			
boam	Top-view	E32-T21-S1 2M	760	450	250	68			
		E32-TC200BR 2M	3,000	1,500	1,050	280			
	Side-view	E32-D24R 2M	100	45	30	8			
	Side-view	E32-D24-S2 2M	180	79	67	14			
		E32-D43M 1M	42	18	12	4			
		E32-D331 2M	21	9	6	2			
		E32-D33 2M	100	45	30	8			
Reflective		E32-D32-S1 0.5M	94		27	7			
Reflective	Tan view	E32-D31-S1 0.5M	94	40	21	′			
	Top-view	E32-DC200F4R 2M	210	90	60	16			
		E32-D22-S1 2M	270	100	100	20			
		E32-D21-S3 2M	370	160	100	30			
		E32-DC200BR 2M	1,260	520	360	100			
		E32-D25-S3 2M	370	160	100	30			

Small-spot, Reflective Models

		Center			Sensing dis	tance (mm)			
Туре	Spot diameter	distance (mm)	Models	Giga mode	Standard mode	High-speed mode	Super-high- speed mode		
Variable spot	0.1 to 0.6 dia.	6 to 15	E32-C42 1M + E39-F3A	Spot diameter of 0.1 to 0.6 mm at 6 to 15 mm.					
variable spot	0.3 to 1.6 dia.	10 to 30	E32-C42 1M + E39-F17	Spot diameter of 0.3 to 1.6 mm at 10 to 30 mm.					
Parallal light	4 dia.	0 to 20	E32-C31 2M + E39-F3C	Spot diameter of 4 mm max. at 0 to 20 mm.					
Faraller light	Parallel light 4 dia.		E32-C31N 2M + E39-F3C	Spot diameter of 4 mm max. at 0 to 20 mm.					
Integrated lens	0.1 dia.	5	E32-C42S 1M	Spot diameter of 0.1 mm at 5 mm.					
integrated tens	6 dia.	50	E32-L15 2M	Spot diameter of 6 mm at 50 mm.					
	0.1 dia.		E32-C41 1M + E39-F3A-5	Spot diameter of	0.1 mm at 7 mm.				
•	0.5 dia.	7	E32-C31 2M + E39-F3A-5	Snot diameter of	0.5 mm at 7 mm.				
	0.5 ula.		E32-C31N 2M + E39-F3A-5	Spot diameter of	0.5 mm at 7 mm.				
Small-spot	0.2 dia.		E32-C41 1M + E39-F3B	Spot diameter of	0.2 mm at 17 mm.				
Small-spot	0.5 dia.	17	E32-C31 2M + E39-F3B	Snot diameter of	0.5 mm at 17 mm				
	0.5 dia.		E32-C31N 2M + E39-F3B	Spot diameter of 0.5 mm at 17 mm.					
	3 dia.	F0	E32-CC200 2M + E39-F18	Spot diameter of 3 mm at 50 mm.					
	5 ula.	50	E32-C11N 2M + E39-F18	Spot diameter of	3 IIIII at 30 IIIII.				

High-power Beam Models

	C!				Sensing dis	tance (mm)	
Туре	Sensing direction	Aperture angle	Models	Giga mode	Standard mode	High-speed mode	Super-high- speed mode
		10°	E32-T17 10M	20,000*1	20,000*1	20,000*1	8,000
Through-beam models with	Top-view	15°	E32-LT11 2M	4,000*2	4,000*2	4,000*2	1,080
integrated lens		15	E32-LT11R 2M	4,000*2	4,000*2	3,450	920
	Side-view	30°	E32-T14 2M	4,000*2	4,000*2	4,000*2	1,800
	Right-angle	12°	E32-T11N 2M + E39-F1	4,000*2	4,000*2	4,000*2	2,000
	Right-angle	6°	E32-T11N 2M + E39-F16	4,000*2	4,000*2	4,000*2	3,600
Ī	Top-view	12°	E32-T11R 2M + E39-F1	4,000*2	4,000*2	4,000*2	2,000
	i op-view	6°	E32-T11R 2M + E39-F16	4,000*2	4,000*2	4,000*2	3,600
Ī	Side-view	60°	E32-T11R 2M + E39-F2	2,170	1,200	750	200
	Top-view	12°	E32-T11 2M + E39-F1	4,000*2	4,000*2	4,000*2	1,860
		6°	E32-T11 2M + E39-F16	4,000*2	4,000*2	4,000*2	4,000*2
Ī	Side-view	60°	E32-T11 2M + E39-F2	3,450	1,980	1,290	320
Through-beam	Top-view	12°	E32-T51R 2M + E39-F1	4,000*2	4,000*2	4,000*2	1,500
models with		6°	E32-T51R 2M + E39-F16	4,000*2	4,000*2	4,000*2	4,000*2
lenses	Side-view	60°	E32-T51R 2M + E39-F2	2,100	1,080	750	200
Ī	Top-view	12°	E32-T81R-S 2M + E39-F1	4,000*2	4,000*2	4,000*2	1,000
	rop-view	6°	E32-T81R-S 2M + E39-F16	4,000*2	4,000*2	4,000*2	1,800
Ī	Side-view	60°	E32-T81R-S 2M + E39-F2	1,500	820	540	140
Ī	Tan view	12°	E32-T61-S 2M + E39-F1	4,000*2	4,000*2	4,000*2	1,800
	Top-view	6°	E32-T61-S 2M + E39-F16	4,000*2	4,000*2	4,000*2	3,100
Ī	Side-view	60°	E32-T61-S 2M + E39-F2	2,520	1,350	900	240
	Tan view	12°	E32-T51 2M + E39-F1-33	4,000*2	4,000*2	3,450	1,400
	Top-view	6°	E32-T51 2M + E39-F16	4,000*2	4,000*2	4,000*2	4,000*2
Reflective models with integrated lens	Top-view	4 °	E32-D16 2M	40 to 4,000 *2	40 to 2,100	40 to 1,350	40 to 480

^{*1.} The fiber length is 10 m on each side, so the sensing distance is given as 20,000 mm. *2. The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

Narrow View Models

Sensing	Sensing			Sensing distance (mm)					
method			Models	Giga mode	Standard mode	High-speed mode	Super-high- speed mode		
		1.5°	E32-A03 2M	4,000*1	2,670	1,800	500		
		1.5	E32-A03-1 2M	4,000*1	2,670	1,000	300		
Through-beam	Side-view	3.4°	E32-A04 2M	1,920	1,020	670	200		
mrougn-beam	Side-view	4°	E32-T24SR 2M	4,000*1	3,300	2,190	580		
			E32-T24S 2M	4,000*1	3,900	2,610	700		
			E32-T22S 2M	4,000*1	4,000*1	3,750	1,000		

^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

Models for Detection without Background Interference

Sensing	Sensing direction	Model	Sensing distance (mm)				
method	Sensing direction	Woder	Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
Limited- reflective	Flat-view	E32-L16-N 2M	0 to 15			0 to 12	
		E32-L24S 2M	0 to 4				
	Side-view E32-L25L 2M		5.4 to 9 (center 7.2)				

Transparent Object Detection (Retro-reflective Models)

Sensing	Feature	Size	Models	Sensing distance (mm)				
method				Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
Retro-reflective	Film detection	M3	E32-C31 2M + E39-F3R + E39-RP37	370		300		
Retro-reflective	Square		E32-R16 5M	150 to 2,250			150 to 1,500	
	Threaded	M6	E32-R21 2M		10 to 370		10 to 250	

Transparent Object Detection (Limited-reflective Models)

Sensing	Feature	Sensing direction	Model	Model Sensing dist					
method	reature	Serising unection	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode		
Small size			E32-L24S 2M		0 to 4				
	Standard	Flat-view	E32-L16-N 2M	0 to 15			0 to 12		
Limited-	Glass substrate alignment, 70°C		E32-A08 2M		10 to 20				
reflective	Standard/long-distance		E32-A12 2M	12 to 30					
	Side-view form	Side-view	E32-L25L 2M	5.4 to 9 (center 7.2)					
	Glass substrate mapping, 70°C	Top-view	E32-A09 2M	15 to 38					

Chemical-resistant, Oil-resistant Models

Sensing	Tuna	Sensing direction	Model		Sensin	g distance (mm)		
method	Туре	Sensing direction	Wodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
	Oil-resistant	Right-angle	E32-T11NF 2M	4,000*1	4,000*1	4,000*1	2,200	
		Top-view	E32-T12F 2M	4,000*1	4,000*1	4,000*1	1,600	
Through-beam	Chemical/oil-resistant	Top-view	E32-T11F 2M	4,000*1	4,000*1	3,900	1,000	
		Side-view	E32-T14F 2M	2,100	1,200	750	200	
	Chemical/oil-resistant at 150°C	Top-view	E32-T51F 2M	4,000*1	4,000*1	2,700	700	
	Semiconductors: Cleaning, developing, and etching; 60°C		E32-L11FP 5M	8 to 20 mm from tip of lens (Recommended sensing distance: 11 mm), 19 to 31 mm from center of mounting hole A (Recommended sensing distance: 22 mm)				
Reflective	Semiconductors: Resist stripping; 85°C	Top-view	E32-L11FS 5M	8 to 20 mm from tip of lens (Recommended sensing distance: 11 mm), 32 to 44 mm from center of mounting hole A (Recommended sensing distance: 35 mm)				
	Chemical/oil-resistant		E32-D12F 2M	*2	280	190	60	
	Chemical-resistant cable		E32-D11U 2M	1,260	520	360	100	

Bending-resistant Models

Sensing	Size	Model	Sensing distance (mm)				
method	Size	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
	1.5 dia.	E32-T22B 2M	1,020	600	330	90	
Through-beam	M3	E32-T21 2M	1,020	000	330	90	
i i i ougii-beaiii	M4	E32-T11 2M	3,750	2,020	1,350	360	
	Square	32-T25XB 2M	750	450	250	70	
	1.5 dia.	E32-D22B 2M	210	90	60	16	
	M3	E32-D21 2M	210			10	
Reflective	3 dia.	E32-D221B 2M	450	210	130	40	
Reflective	M4	E32-D21B 2M	450	210	130	40	
	M6	E32-D11 2M	1,260	520	360	100	
	Square	E32-D25XB 2M	360	150	90	30	

^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.
*2. Even if there is no sensing object, the Sensor will detect light that is reflected by the fluororesin.

Heat-resistant Models

Sensing	Heat-resistant temperature	Model	Sensing distance (mm)				
method	neat-resistant temperature	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
	100°C	E32-T51R 2M	2,400	1,200	840	225	
Through-beam	150°C	E32-T51 2M	4,000*1	2,250	1,500	400	
Tillough-beam	200°C	E32-T81R-S 2M	1,500	820	540	140	
	350°C	E32-T61-S 2M	2,520	1,350	900	240	
	100°C	E32-D51R 2M	1,000	420	280	80	
	150°C	E32-D51 2M	1,680	670	480	144	
	200°C	E32-D81R-S 2M	630	270	180	54	
Reflective	300°C	E32-A08H2 2M		10 to 20			
Reliective	300 C	E32-A09H2 2M		20 to 30 (center 2	5)		
	350°C	E32-D611-S 2M	630	270	180	54	
	350 C	E32-D61-S 2M	630	270	160	54	
	400°C	E32-D73-S 2M	420	180	120	36	

^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

Area Detection Models

Sensing	Туре	Sensing width	Model		Sensir	ng distance (mm)	
method	Туре	Sensing width	Wiodei	Giga mode	Standard mode	High-speed mode	Super-high-speed mode
Through-beam Are		11 mm	E32-T16PR 2M	4,000*1	2,550	1,680	440
	Area		E32-T16JR 2M	4,000*1	2,250	1,440	380
		30 mm	E32-T16WR 2M	4,000*1	3,900	2,550	680
Reflective	Array	11 mm	E32-D36P1 2M	1,050	450	300	90

^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

Liquid-level Detection Models

Sensing method	Tube diameter	Feature	Model	Sensing distance (mm)			
				Giga mode	Standard mode	High-speed mode	Super-high-speed mode
	3.2, 6.4, or 9.5 dia	Stable residual quantity detection	E32-A01 5M	Applicable tube: Transparent tube with a diameter of 3.2, 6.4, or 9.5 mm, Recommended wall thickness: 1 mm			
Tube-mounting	8 to 10 dia	Mounting at multiple levels	E32-L25T 2M	Applicable tube: Transparent tube with a diameter of 8 to 10 mm, Recommended wall thickness: 1 mm			
	No restrictions	Large tubes	E32-D36T 5M	Applicable tube: Transparent tube (no restrictions on diameter)			
Liquid contact (heat-resistant up to 200°C)			E32-D82F1 4M	Liquid-contact type			

Vacuum-resistant Models

Sensing method	Heat-resistant temperature	Model	Sensing distance (mm)			
	neat-resistant temperature		Giga mode	Standard mode	High-speed mode	Super-high-speed mode
Through-beam		E32-T51V 1M	1,080	600	390	100
	120°C	E32-T51V 1M + E39- F1V	2,000*1	2,000*1	2,000*1	520
	200°C	E32-T84SV 1M	2.000*1	1,420	960	260

^{*1.} The fiber length is 1 m on each side, so the sensing distance is given as 2,000 mm.

Models for FPD, Semiconductors, and Solar Cells

Sensing	Application	Operating temperature	Model	Sensing distance (mm)				
method				Giga mode	Standard mode	High-speed mode	Super-high-speed mode	
	Glass presence detection	70°C	E32-L16-N 2M	0 to 15			0 to 12	
	Glass substrate alignment		E32-A08 2M	10 to 20				
		300°C	E32-A08H2 3M	10 to 20				
		7000	E32-A12 2M	12 to 30				
Limited-	Glass substrate mapping	70°C	E32-A09 2M	15 to 38				
reflective		300°C	E32-A09H2 2M	20 to 30 (center 25)				
	Wet processes: Cleaning, Resist developing and etching	60°C	E32-L11FP 5M	8 to 20 mm from tip of lens (Recommended sensing distance: 11 mm), 19 to 31 mm from center of mounting hole A (Recommended sensing distance: 22 mm				
	Wet process: Resist stripping	85°C	E32-L11FS 5M	8 to 20 mm from tip of lens (Recommended sensing distance: 11 mm), 32 to 44 mm from center of mounting hole A (Recommended sensing distance: 35 mm				
	Wafer mapping	70°C	E32-A03 2M	4,000*1	2,670	1,800	500	
			E32-A03-1 2M	4,000*1			500	
Through-beam			E32-A04 2M	1,920	1,020	670	200	
			E32-T24SR 2M	4,000*1	3,300	2,190	580	
			E32-T24S 2M	4,000*1	3,900	2,610	700	


^{*1.} The fiber length is 2 m on each side, so the sensing distance is given as 4,000 mm.

I/O Circuit Diagrams


NPN Output

Model	Operation mode	Timing chart	L/D indicator	Output circuit
E3NX-FA11 E3NX-FA6	Light-ON	Incident light No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black leads)	L lit.	Display OUT indicator (orange) Brown Black Load Control output 10 to
	Dark-ON	Incident light No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black leads)	D lit.	Photoeledric sersor main circuit Blue
E3NX-FA21	Light-ON	ch1/ Incident light ch2 No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black (orange) leads)	L lit.	Display OUT2 indicator (orange) Brown Black Load Out1 indicator (orange) Out1 indicator (orange) Orange cht 10 to
	Dark-ON	ch1/ Incident light ch2 No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black (orange) leads)	D lit.	Photoelectric sensor main circuit Pink ch2 Blue Input Orange of 30 VDC External Blue input
E3NX-FA7 E3NX-FA24	Light-ON	Incident light No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black leads)	L lit.	Display OUT indicator (orange) Brown Black Control output 10 to 30 VDC Orange
	Dark-ON	Incident light No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black leads)	D lit.	M8 Connector Pin Arrangement
E3NX-FA7TW	Light-ON	ch1/ Incident light ch2 No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black (orange) leads)	L lit.	Display OUT2 indicator Brown OUT3 indicator OUT4 indicator Orange Orange Orange Orange Orange Orange Orange Orange
	Dark-ON	ch1/ Incident light ch2 No incident light OUT indicator Lit (orange) Not lit Output ON transistor OFF Load Operate (e.g., relay) Reset (Between brown and black (orange) leads)	D lit.	Photoelectric sersor main circuit Control output ch2 Blue

PNP Output

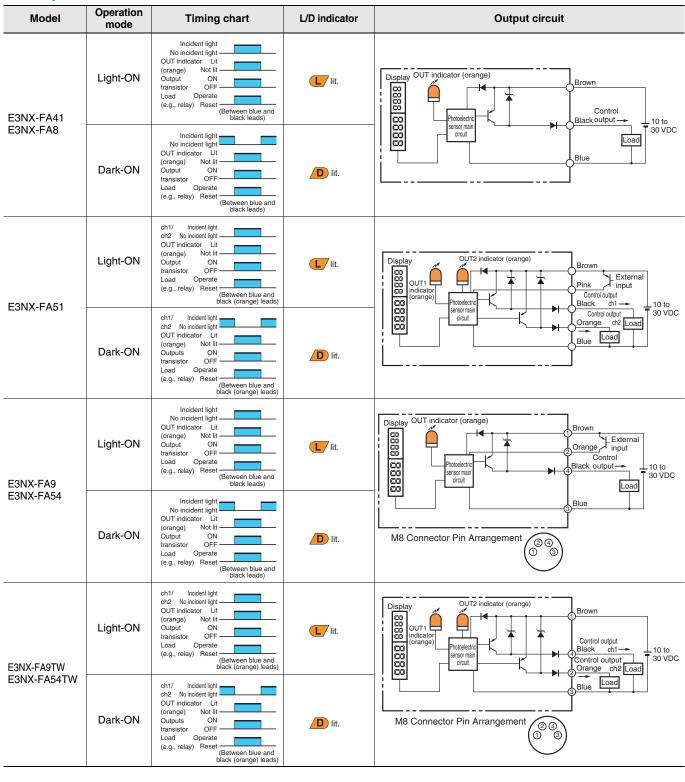


Plug (Sensor I/O Connector)




Wire color	Connection pin	Application
Brown	1	Power supply (+V)
White	2	External input / Output
Blue	3	Power supply (0 V)
Black	4	Output

Nomenclature

E3NX-FA11/FA41/FA6/FA8/FA7/FA9/FA24/FA54

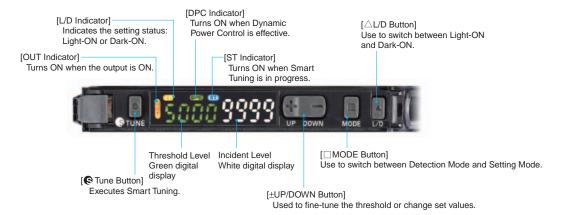

E3NX-FA21/FA51/FA7TW/FA9TW/FA54TW/FA0

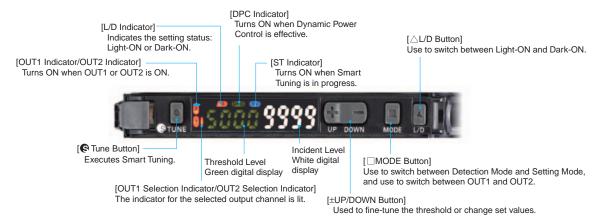

Safety Precautions

To ensure safe operation, be sure to read and follow the Instruction Manual provided with the Sensor.

WARNING

This product is not designed or rated for ensuring safety of persons either directly or indirectly. Do not use it for such purposes.



Do not use the product with voltage in excess of the rated voltage. Excess voltage may result in malfunction or fire.



Never use the product with an AC power supply. Otherwise, explosion may result.



Precautions for Safe Use

The following precautions must be observed to ensure safe operation of the Amplifier Unit. Doing so may cause damage or fire.


- 1. Do not install the product in the following locations.
- · Locations subject to direct sunlight
- Locations subject to condensation due to high humidity
- · Locations subject to corrosive gas
- Locations subject to vibration or mechanical shocks exceeding the rated values
- · Locations subject to exposure to water, oil, chemicals
- Locations subject to stream
- · Locations subjected to strong magnetic field or electric field
- 2. Do not use the product in environments subject to flammable or explosive gases.
- **3.** Do not use the product in any atmosphere or environment that exceeds the ratings.
- **4.** To secure the safety of operation and maintenance, do not install the product close to high-voltage devices and power devices.
- High-voltage lines and power lines must be wired separately from the product. Wiring them together or placing them in the same duct may cause induction, resulting in malfunction or damage.
- Do not apply any load exceeding the ratings. Otherwise, damage or fire may result.
- 7. Do not short the load. Otherwise, damage or fire may result.
- 8. Do not use the product if the case is damaged.
- Burn injury may occur. The product surface temperature rises depending on application conditions, such as the ambient temperature and the power supply voltage. Use caution when operating or cleaning the product.
- 10. When setting the sensor, be sure to check safety such as by stopping the equipment.
- 11.Be sure to turn off the power supply before connecting or disconnecting wires.
- 12.Do not attempt to disassemble, repair, or modify the product in any way.
- 13. When disposing of the product, treat it as industrial waste.

Precautions for Correct Use

- 1. Connect the load correctly.
- 2. Do not miswire such as the polarity of the power supply.
- B. Be sure to mount the unit to the DIN track until it clicks.
- 4. When using the Amplifier Units with Wire-saving Connectors, attach the protective stickers (provided with E3X-CN-series Connectors) on the unused power pins to prevent electrical shock and short circuiting. When using Amplifier Units with Connectors for Communications Units, attach the protective caps.

Amplifier Unit with Connector


Amplifier Unit with Wiresaving Connector





- Use an extension cable with a minimum thickness of 0.3 mm² and less than 100 m long.
- **6.** Do not apply the forces on the cord exceeding the following limits: Pull: 40N; torque: 0.1N·m; pressure: 20N; bending: 29.4N
- Do not apply excessive force (9.8 N max.) such as tension, compression or torsion to the Amplifier Unit with the Fiber Unit fixed to the Amplifier Unit.
- 8. Always keep the protective cover in place when using the Amplifier Unit. Not doing so may cause malfunction.
- It may take time until the received light intensity and measured value become stable immediately after the power is turned on depending on use environment.
- **10.** The product is ready to operate 200 ms after the power supply is turned ON.
- 11. The Mobile Console E3X-MC11, E3X-MC11-SV2 and E3X-MC11-S cannot be connected.
- **12.**The mutual interference prevention function does not work when in combination with E3C/E2C/E3X.
- 13.If the unit receives excessive sensor light, the mutual interference prevention function may not work properly, resulting in malfunction of the unit. In such case, increase the threshold.
- 14.Standard models and Advanced models The Sensor Communication Unit E3X-DRT21-S, E3X-CRT, E3X-ECT and E3NW cannot be connected. Model for Sensor Communication Unit (E3NC-FA0) The Sensor Communication Unit E3NW can be connected.
- E3X-DRT21-S, E3X-CRT, E3X-ECT cannot be connected. **15.**If you notice an abnormal condition such as a strange odor, extreme heating of the unit, or smoke immediately stop using the product, turn off the power, and consult your dealer.
- **16.**Do not use thinner, benzene, acetone, and lamp oil for cleaning.

(Unit: mm)


Fiber Amplifier Units

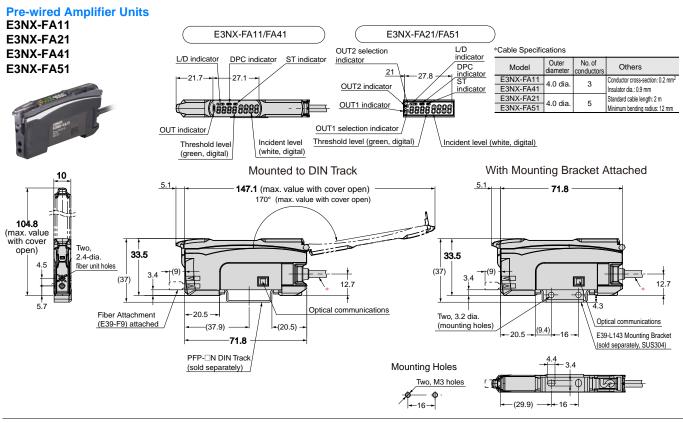

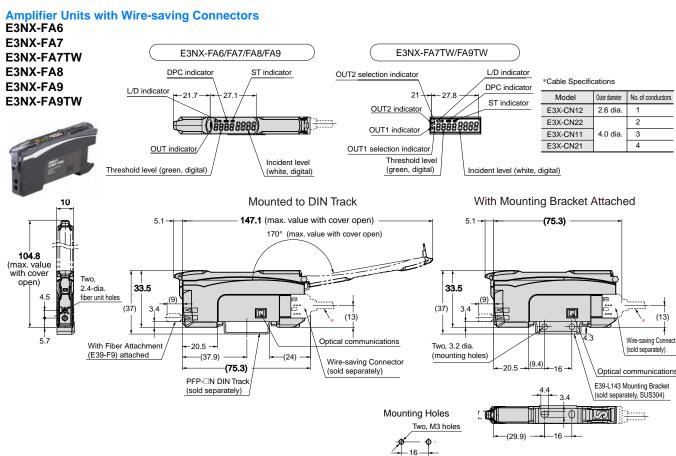

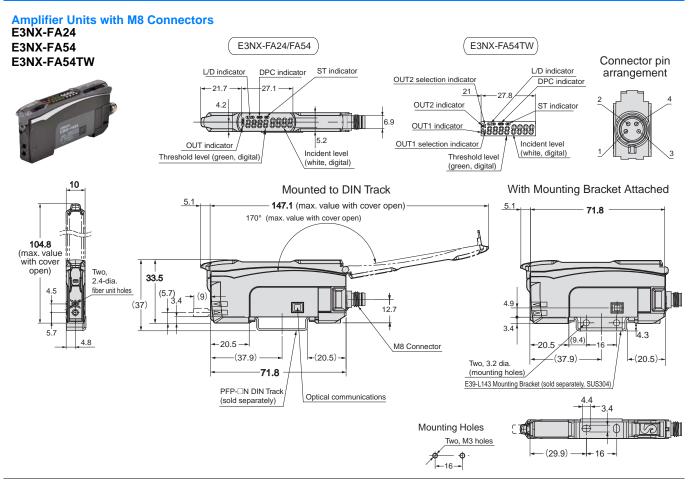


Amplifier Unit with Connector for Sensor Communications Unit E3NX-FA0

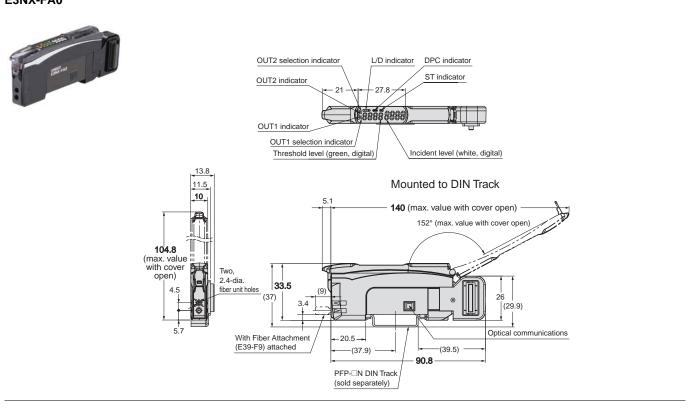


Accessories (Sold Separately)

Wire-saving Connectors

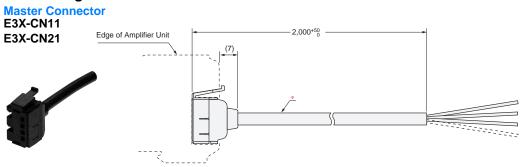

* E3X-CN11: 4-dia. cable with 3 conductors, Standard cable length: 2 m (Conductor cross-section: 0.2 mm² (AWG24), Insulator diameter: 1.1 mm) E3X-CN21: 4-dia. cable with 4 conductors, Standard cable length: 2 m (Conductor cross-section: 0.2 mm² (AWG24), Insulator diameter: 1.1 mm)

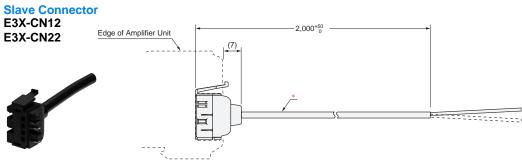


* E3X-CN12: 2.6-dia. cable with 1 conductor, Standard cable length: 2 m (Conductor cross-section: 0.2 mm² (AWG24), Insulator diameter: 1.1 mm) E3X-CN22: 4-dia. cable with 2 conductors, Standard cable length: 2 m (Conductor cross-section: 0.2 mm² (AWG24), Insulator diameter: 1.1 mm)

Sensor I/O Connectors

Straight


XS3F-M421-40□-A





L-shaped XS3F-M422-40□-A




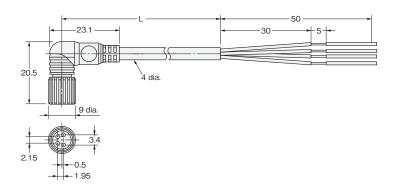

Mounting Bracket E39-L143




Material: Stainless steel (SUS304)

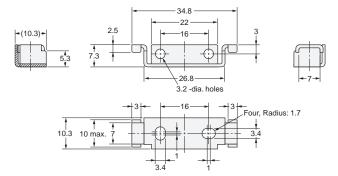



DIN Track PFP-100N PFP-50N






Material: Aluminum

PFP-100N2







Material: Aluminum

End Plate

PFP-M







Materials: Iron, zinc plating

Terms and Conditions Agreement

Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

Warranties.

- (a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.
- (b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE

PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warranty.

See http://www.omron.com/global/ or contact your Omron representative for published information.

Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

<u>Errors and Omissions.</u> <u>Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is accurate.</u> assumed for clerical, typographical or proofreading errors or omissions.

2013.10

In the interest of product improvement, specifications are subject to change without notice.

